

Publishing date	07/11/2019
Document number	SUPAIR_2019_10_002_EN
Page number	1/1



SAFETY WARNING


SUBJECT : ACRO 4 Harness : Stitching Flaw

STATUT : LOW
 MEDIUM
 CRITICAL

Nature of the Problem

We have identified a problem at one of our client outlets wherein we found a harness missing safety stitching on a ACRO 4 harness produced in March 2019. One of the shoulder webbings was not correctly sewn with the ventral cross strap, but only pre-glued before the automatic manufacturing phase.

We do two inspections on our harnesses. The first is at the end of production, and the second is before expedition to our clients. With the ACRO 4 we reinforced the inspections at the end of manufacturing in particular, and have done so since September 2019.

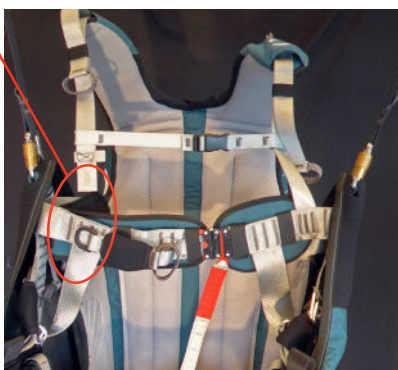


Product in question : ACRO 4 harnesses produced before September 2019

Procedure to follow :

Check your harness.

We are asking pilots using the ACRO 4 to verify that their shoulder straps are well sewn to the ventral straps (and not merely glued). Check for automatic vertical stitching (3 stitches) to the ventral strap.

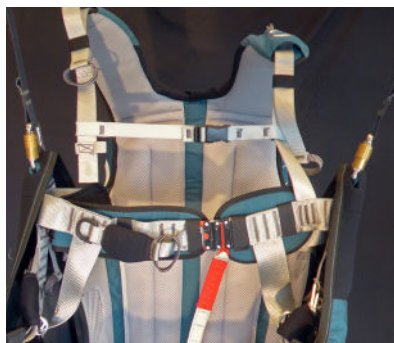

The 3 automatic vertical stitching are missing



DO NOT FLY!
Please contact
sav@supair.com
Do not use the harness until properly checked

OK

The 3 automatic vertical stitching are there



Blue Skies!