

Publication date	21/10/2015
Document nr.	SUPAIR_2015/10_001
Number of page	1 / 4



## SAFETY NOTE

RATING :  LOW  
 AVERAGE  
 CRITICAL

TOPIC : ALTIRANDO2RS rescue handle release

### Problem's description :

Pulling the handle might be more difficult than expected in certain cases, slowing down deployment of the reserve.



### Concerned products :

ALTIRANDO<sup>2</sup> RS (index : A1 to B3)

### Event / Ascertainment :

During a hang test, we noted some difficulties in removing the rescue handle from the housing. This is due to the presence of a velcro strap on one of the rescue pocket folds.

Next page ►


<b>Publication date</b>	21/10/2015
<b>Document nr.</b>	SUPAIR_2015/10_001
<b>Number of page</b>	2 / 4

## Process :

*How to find my harness's production index ?*

Open the flap located on the shoulder straps, find the production index on the label.

*Try extracting the reserve in a hang test.*

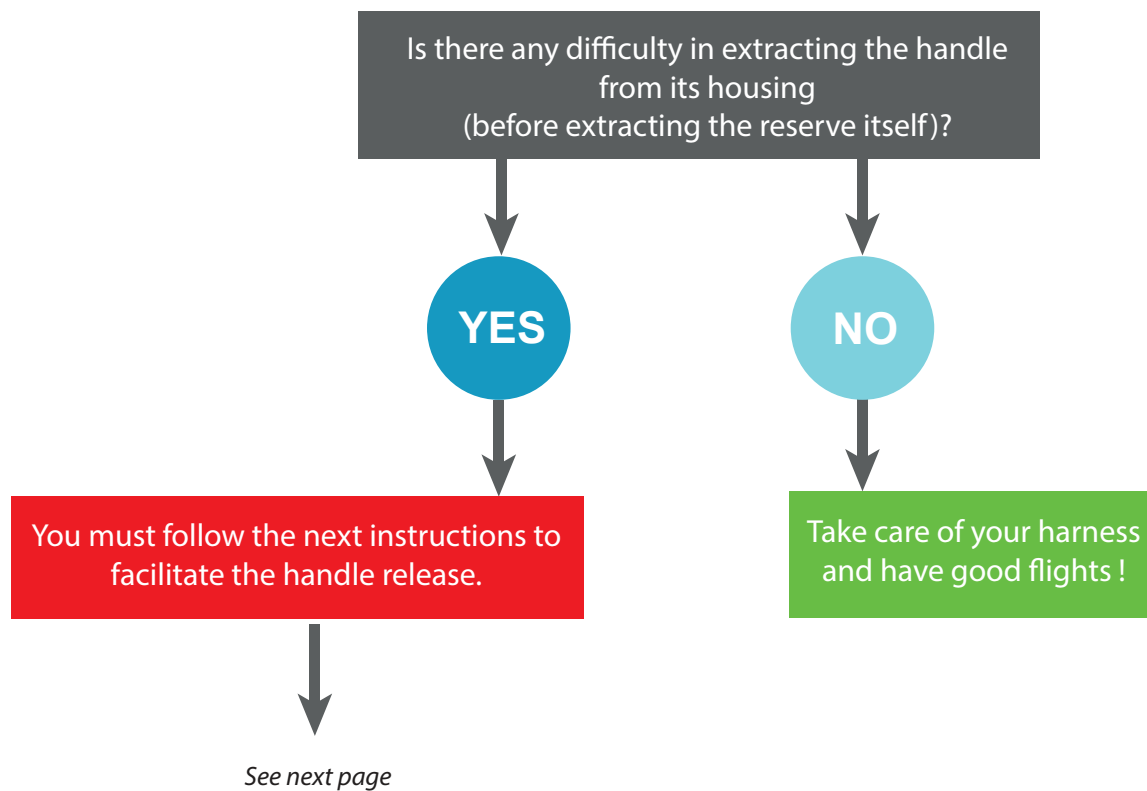

Next page ►

Publication date	21/10/2015
Document nr.	SUPAIR_2015/10_001
Number of page	3 / 4

- 1 Identify the flap where the velcro is sewn :  
"Altirando2 RS" embroidered flap

And

Identify the sewn Velcro



"A" Extremity

"B" Extremity



- 2 Make an incision in the Velcro at the "B" end.



The B end is then released.  
(Identical configuration to the "A" end)




See next page

Next page ►

Publication date	21/10/2015
Document nr.	SUPAIR_2015/10_001
Number of page	4 / 4

3

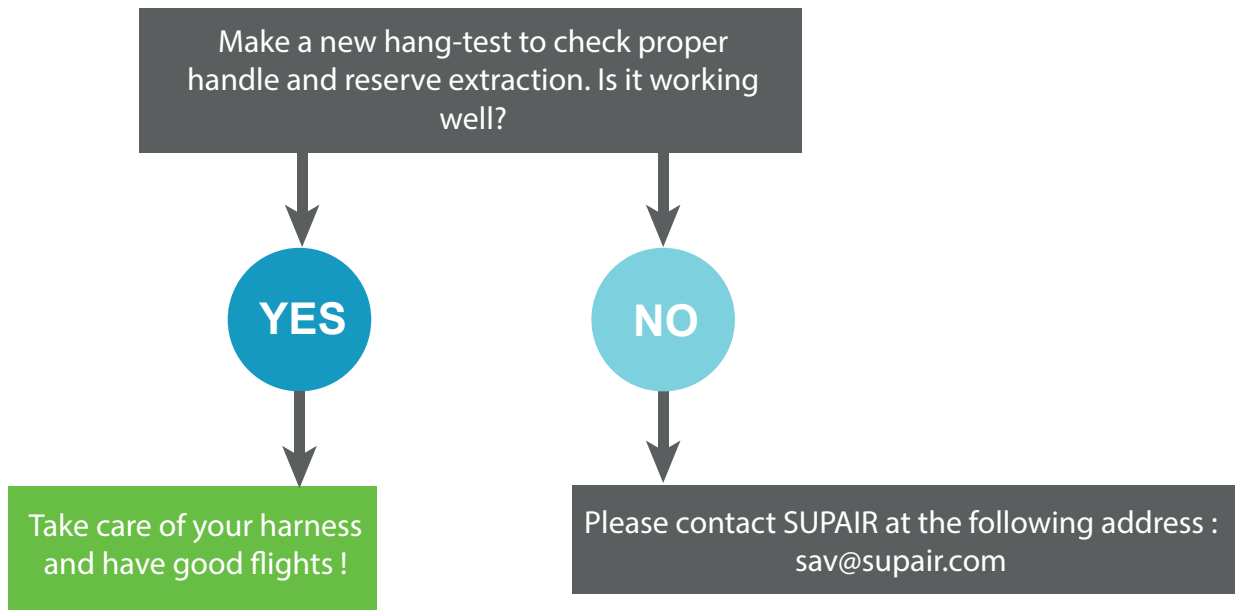

### Person able to perform the checking :

USER

DEALER

MANUFACTURER

### When should you check your harness ?

**The checking procedure shall be performed immediately**

### Receivers :

USER

DEALER

PARAGLIDING SCHOOL

PARAGLIDING ASSOCIATION

PRESS

FEDERATION

Safety note : SUPAIR\_2015/10\_001